

LEISTER®

English

VARIMAT 700

Leister Quality
System (LQS)



Leister Technologies AG
Galileo-Strasse 10
6056 Kaegiswil
Switzerland
+41 41 662 74 74
leister@leister.com
leister.com

Table of contents	
1. Operating Unit	4
1.1. Function keys	4
1.2. Display areas	4
1.3. Display description	5
2. Overview of the LQS Settings	6
2.1. Machine settings	6
2.2. Settings LQS	7
3. Functional Description of Welding Data Recording	10
4. Preparing for Welding Data Recording	11
4.1. Settings Machine settings	12
4.2. Settings LQS	13
5. Running Welding Data Recording	17
6. Welding Data Recording	18
6.1. Representation of limit value exceedance	18
6.2. Welding data files	19
7. Welding Without Recording of Data	20
8. Behavior of Data Recording in Case of Power Outage	21
9. Data Synchronization	22
9.1. Switching on the WLAN module	22
10. Warnings and Error Messages	23
11. Quick Guide LQS App	25
11.1. First start	25
11.2. Update existing LQS app with Cloud work mode	26
11.3. Configuring the Cloud Sharing work mode	26
11.4. Managing the company and users	27
12. myLeister App User Interface	29
12.1. LQS	29
12.2. Devices	29
12.3. Recipes	29
12.4. LiveView	30
12.5. Configuration Management	30
12.6. myLeister AR App	30
12.7. Settings	30
12.8. Help	32

13. Registration of Devices	33
14. LQS Functions	34
14.1. Synchronizing data from the device.	34
14.2. Restoring an archive of the device	34
14.3. Evaluating welding data	34
14.4. Navigating within graphics (Windows version only)	35
15. Recipes	36
16. Tools	36
17. Documents (Android and iOS versions only)	37
17.1. Account	37
17.2. Work mode	37

Congratulations on the purchase of your VARIMAT 700.

You have chosen a first-class hot-air welder.

It was developed and produced in accordance with the latest state-of-the-art technology in the plastics-processing industry.

It has also been manufactured using high-quality materials.



Please always store these operating instructions with the device.


VARIMAT 700 with Leister Quality System (LQS)



You can find more information on the VARIMAT 700 at leister.com

1. Operating Unit


1.1. Function keys

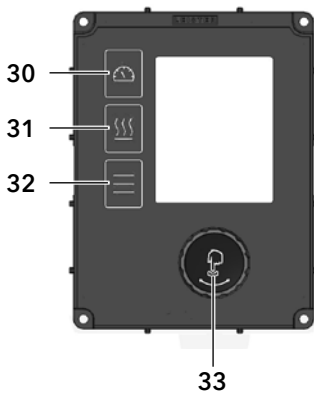

- 30. Button *Drive On/Off*
- 31. Button *Heating On/Off*
- 32. Button *Menu*
- 33. *e-Drive*

1.2. Display areas

The display is subdivided into two display areas:

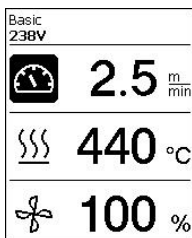

40 Status display

41 Working display

1.3. Display description

1.3.1. Status display "Section 1" (40)

Name of the saved value	Welding parameters currently selected. If names consist of more than 6 characters, the first 6 characters are shown first, followed by the remaining characters.
226 V	Current supply voltage at power plug
No. 2	Current file number of the welding data record

1.3.2. Icons for the status display "Area 2" (40)



Warning present



Data recording



Overvoltage



Eco mode



GPS data reception



Undervoltage



WLAN



Stop Device on Alert
switched on



Heating



Application protection
switched on



Application protection
active

2. Overview of the LQS Settings

2.1. Machine settings

Date & Time

Basic 230V
Machine Settings
< Settings
Data & Time >
Unit >
LCD Contrast [%] 89
LCD Backlight wh [%] 90
LCD Backlight rd [%] 90
Key Backlight <input type="checkbox"/>

Basic 231V
Date & Time
< Machine Settings
Hour 13
Minute 38
Year 2021
Month 1
Day 8

Setting date and time.

App. Protection

Basic 232V
Machine Settings
< Settings
Data & Time >
App. Protection >
Unit >
Work Light >
LCD Contrast [%] 90
LCD Backlight wh [%] 85

Basic 232V
6060
1 2 3 4 5 6 7 8 9 0
Q W E R T Z U I O P
A S D F G H J K L
↑ Y X C V B N M ↵
+ - . / ← →
✓

After entering the password (6060), you can activate the Application Protection Mode.
The range of the setpoints can be limited here as required.

Basic 232V
App. Protection
< Machine Settings
App. Protection Mode <input checked="" type="checkbox"/>
Speed min [m/min] 1.0
Speed max [m/min] 10.0
Heat min [°C] 100
Heat max [°C] 620
Vol min [%] 45

Unit

Basic 229V
Machine Settings
< Settings
Data & Time >
Unit >
LCD Contrast [%] 89
LCD Backlight wh [%] 90
LCD Backlight rd [%] 90
Key Backlight <input type="checkbox"/>

Basic 230V
Unit
< Machine Settings
Global Unit metric
Unit Speed metric
Unit Heat metric

Global unit
Setting the unit used (metric/imperial) for Unit Speed and (°C/°F) for the Unit Heat.

Unit Speed
Individual setting of the unit used for speed (metric/imperial).

Unit Heat
Individual setting of the unit used for heat (metric/imperial).

2.2. Settings LQS

LQS

Basic 235V	
LQS	
< Settings	
Data Recording	<input checked="" type="checkbox"/>
Monitored Welding	<input type="checkbox"/>
Seam Naming	<input type="checkbox"/>
Rec. Interval [cm]	40
Number of Files	0
Free Memory [GB]	7.62

If Data Recording is activated, the welding data is logged.

Test Welding

Basic 233V	
LQS	
< Settings	
Data Recording	<input checked="" type="checkbox"/>
Test Welding	<input checked="" type="checkbox"/>
Monitored Welding	<input type="checkbox"/>
Seam Naming	<input type="checkbox"/>
Rec. Interval [cm]	40
Number of Files	25

If Test Welding is switched on, you can make a test weld before the actual welding process.

Monitored Welding

Basic 232V	
LQS	
< Settings	
Data Recording	<input checked="" type="checkbox"/>
Monitored Welding	<input checked="" type="checkbox"/>
Stop Device on Alert	<input type="checkbox"/>
Audible Alarm	<input type="checkbox"/>
Alarm Speed Tol. [%]	4
Alarm Heat Tol. [°C]	10

If Monitored Welding is switched on, limit values of the recorded welding parameters are logged.

Stop Device on Alert

Basic 232V	
LQS	
< Settings	
Data Recording	<input checked="" type="checkbox"/>
Monitored Welding	<input checked="" type="checkbox"/>
Stop Device on Alert	<input checked="" type="checkbox"/>
Audible Alarm	<input type="checkbox"/>
Seam Naming	<input type="checkbox"/>
Rec. Interval [cm]	40

If Stop Device on Alert is activated, the drive and the heater are switched off after 30 seconds if the limit value is exceeded. The limit values can be set:

Standard values are:
Speed 4 %
Temperature +/-10 °C
Blower speed 3 %.

Audible Alarm



Basic
234V

LQS

< Settings

Data Recording

Monitored Welding

Stop Device on Alert

Audible Alarm

Seam Naming

Rec. Interval [cm] 40

If the Audible Alarm is switched on, an acoustic alarm sounds when the limit value is exceeded.



Basic
229V

LQS

< Settings

Data Recording

Monitored Welding

Stop Device on Alert

Audible Alarm

Alarm Speed Tol. [%] 4

Alarm Heat Tol. [°C] 10

Alarm Speed tol. [%]

Alarm heat tol. [°C]

Alarm vol. tol. [%]

If Stop Device on Alert is deactivated, the limit values can be set individually.

Seam Naming



Basic
234V

LQS

Stop Device on Alert

Audible Alarm

Alarm Speed Tol. [%] 4

Alarm Heat Tol. [°C] 10

Alarm Vol. Tol. [%] 4

Seam Naming

Seam Name >

If Seam Naming is activated, the freely selectable "SeamName" is added to the file name.

Seam Name



Basic
230V

SEAM-1

1 2 3 4 5 6 7 8 9 0

Q W E R T Z U I O P

A S D F G H J K L

↑ Y X C V B N M ↵

- ← →

✓

Enter a name affix. This name affix is attached to the file name.

Protocol number: 20210303-SEAM-1

Recording interval



Basic
232V

LQS

Alarm Speed Tol. [%] 4

Alarm Heat Tol. [°C] 10

Alarm Vol. Tol. [%] 5

Seam Naming

Seam Name >

Rec. Interval [cm] 40

Number of Files 13

This allows determining the recording interval.

After covering a distance interval, a dataset of welding data is recorded and saved.

Number of Files

Basic	
234V	
LQS	
Alarm Heat Tol. [°C]	10
Alarm Vol. Tol. [%]	5
Seam Naming	<input checked="" type="checkbox"/>
Seam Name	>
Rec. Interval [cm]	20
Number of Files	13
Free Memory [MB]	7620

Number of new recording files. These files must be synchronized in order to evaluate them using the myLeister App. Each day, the numbering of the files restarts at 001.

Free Memory Space

Basic	
234V	
LQS	
Alarm Vol. Tol. [%]	5
Seam Naming	<input checked="" type="checkbox"/>
Seam Name	>
Rec. Interval [cm]	20
Number of Files	13
Free Memory [MB]	7620
GPS	<input type="checkbox"/>


Free memory space on the memory card.
Capacity: at least 8 GB.

GPS

Basic	
229V	
LQS	
Seam Naming	<input checked="" type="checkbox"/>
Seam Name	>
Rec. Interval [cm]	20
Number of Files	1
Free Memory [MB]	7621
GPS	<input checked="" type="checkbox"/>
GPS Position	>

If GPS is activated, position information is recorded by the GPS module.

GPS Position

Basic	
235V	
GPS Position 	
N 46° 54.8271'	
Longitude	
E 8° 15.5502'	
Elevation	
468.19 m	
Satellites in view	10
HDOP	1.91

Current geographic position if the GPS module has sufficient satellite reception and can determine a position.

3. Functional Description of Welding Data Recording

- The welding data recording function logs temperature, speed, blower power and supply voltage during the welding process along the weld's length at predefined distance intervals.
- Optionally, if applicable, the additional weight is also logged.
- Limit values can be set for temperature, speed and blower power.
- During welding data recording, the automatic welder logs when a limit value is left and emits an acoustic and visual alarm signal. Monitored welding and Audible alarm must be activated for this.
- The recorded data are analyzed through the separate myLeister App user software.

The graphic shown below shows the process of welding with Stop Device on Alert activated. Horizontally, the distance over the weld seam length is listed in each case. Vertically, temperature, speed, blower power and mains voltage are recorded in the relevant diagrams.


In this example, the mains voltage at the end of the welding process is so low that the temperature limit (-10°C) can no longer be maintained. The machine stops the welding process.

Seam number 1 (Stop Device on Alert)


Hot air temperature [$^{\circ}\text{C}$]




Speed [m/min]

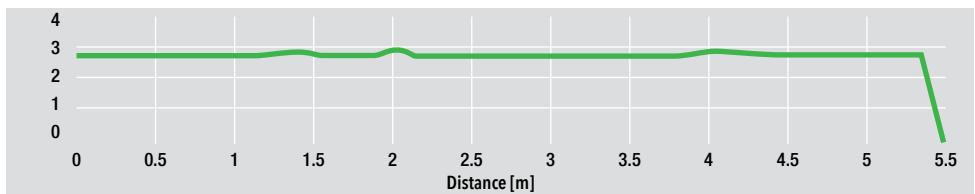

Air volume [%]

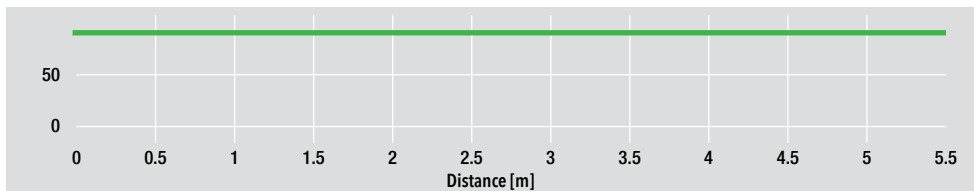

Voltage [V]

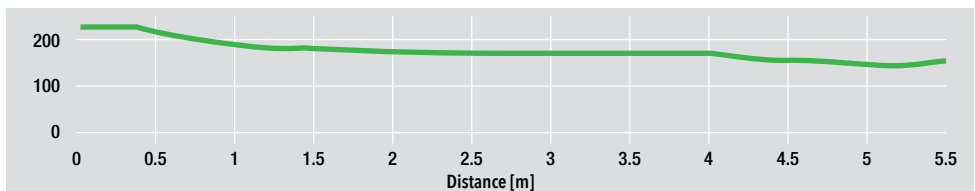


4. Preparing for Welding Data Recording

In the Machine Settings menu, check Unit and Date & Time and adjust, if necessary.

In the LOS menu, the following parameters must be set before the welding data are recorded:

- check whether welding data recording Data Recording is activated
- Optionally, as required: Activate Test Welding, Monitored Welding and Stop Device on Alert
- activate or deactivate the acoustic alarm Audible Alarm as needed
- if Stop Device on Alert is switched off, set limit values for speed, temperature and blower power as required
- optional as needed: Activate or deactivate name suffix Seam Naming
- optional as needed: enter joint name suffix Seam Name
- set distance interval for recording
- Deactivate or activate GPS position recording as needed


4.1. Settings Machine settings

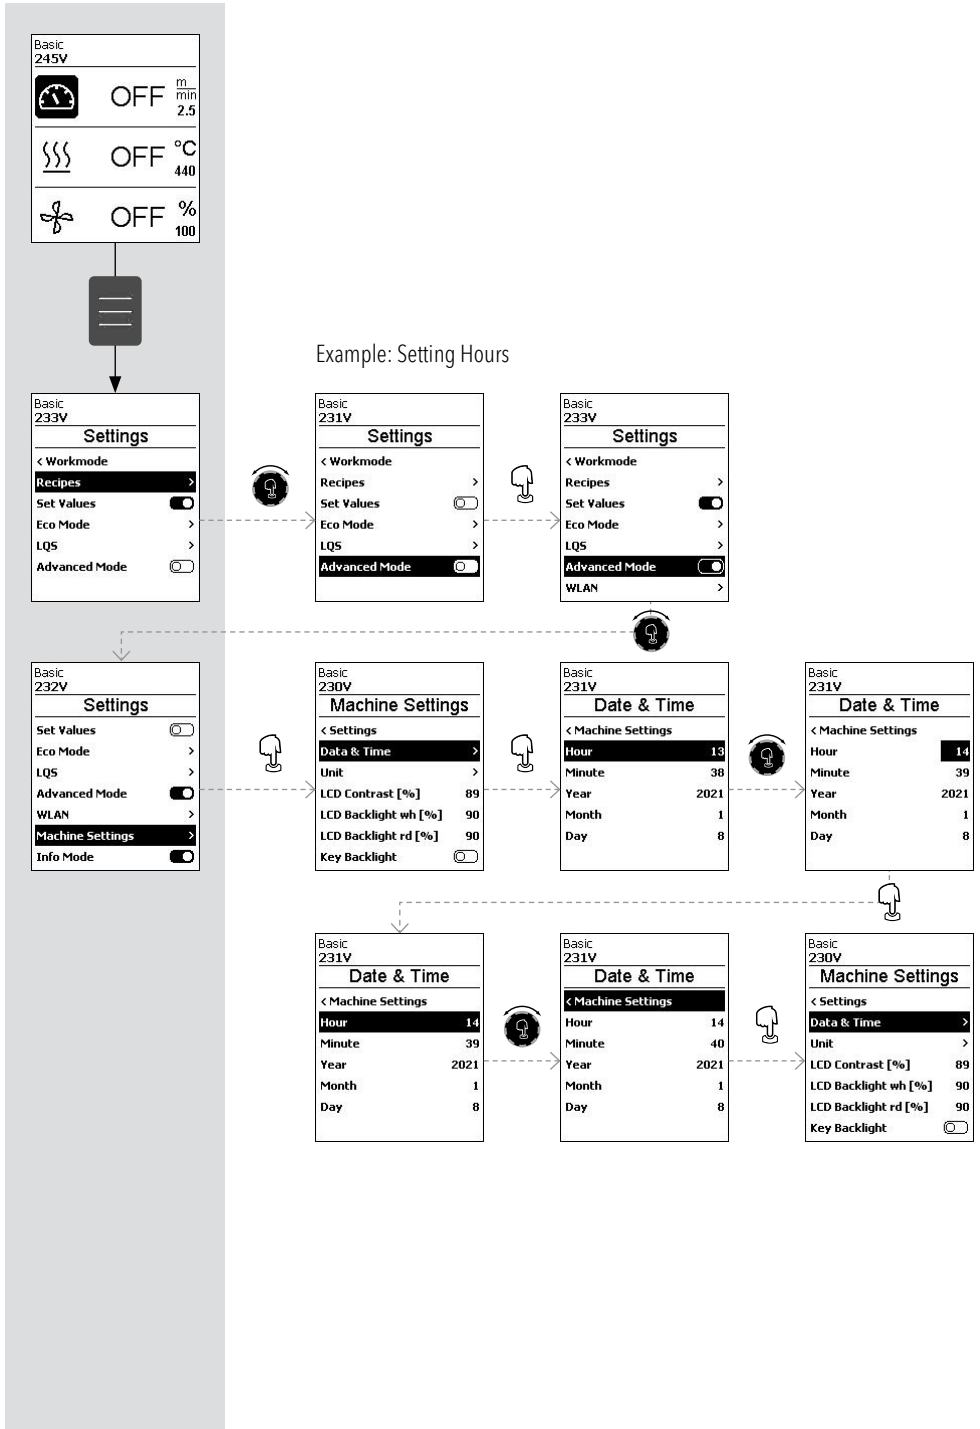


Example: Setting Hours

4.2. Settings LQS

4.2.1. Switching on data recording

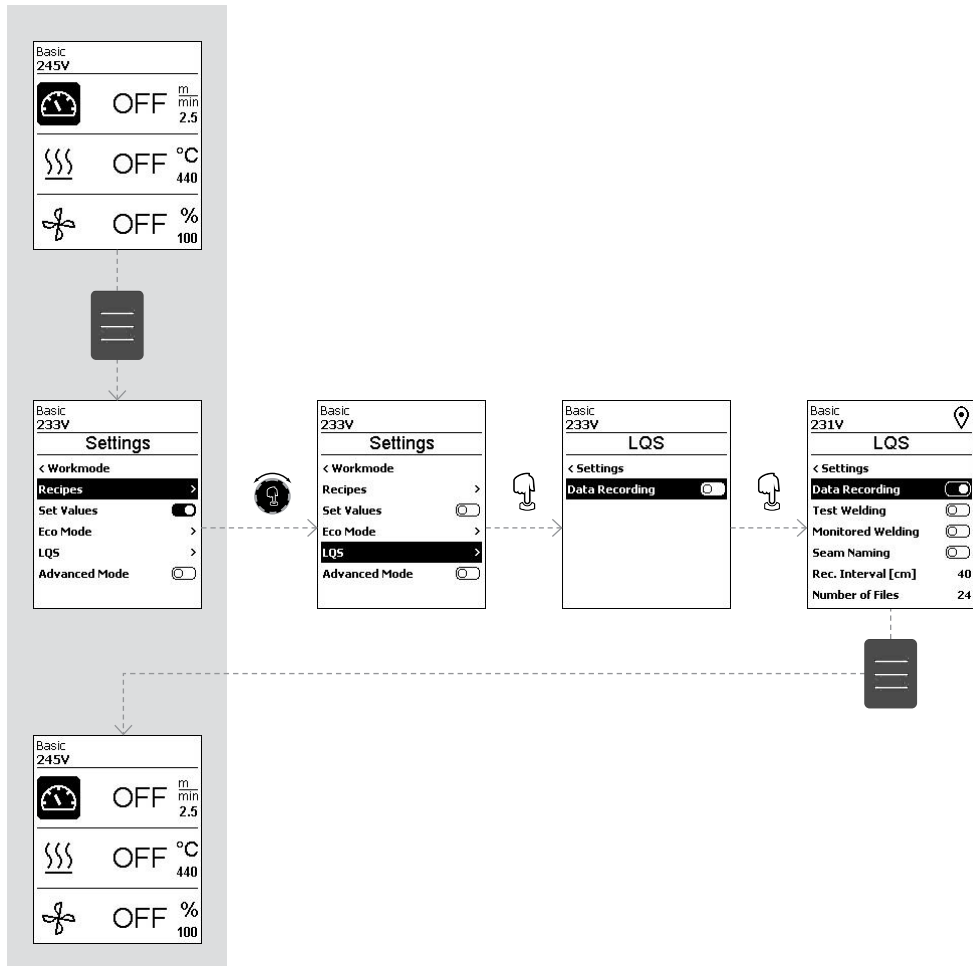

4.2.2. Test Welding

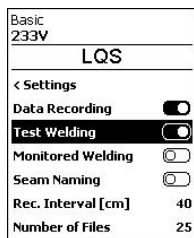

If Test Welding is switched on, a test weld can be performed before the actual welding process.

4.2.3. Monitored Welding



If Monitored welding is switched on, limit value deviations from the recorded welding parameters are logged.

If you only want to record the welding data without monitoring, you can deactivate Monitored Welding.

4.2.4. Stop Device on Alert



If Stop Device on Alert is switched on, the welding process is stopped after 30 seconds if a limit value deviation occurs. The limit values are automatically adopted according to the table below.

Parameters		Value		Imperial value
Alarm Speed tol.	[%]	2	[%]	2
Alarm Heat tol.	[°C]	10	[°F]	50
Alarm vol. tol.	[%]	3	[%]	3



If Stop Device on Alert is switched off, you can set the limit values individually according to the table below.

Parameters		Setting range		Setting range imperial
Alarm Speed tol.	[%]	2-10	[%]	2-10
Alarm Heat tol.	[°C]	5-30	[°F]	41-86
Alarm vol. tol.	[%]	2-10	[%]	2-10
Rec. Interval	[cm]	10-2000	[in]	4-787


4.2.5. Audible Alarm



If Audible Alarm is switched on, an acoustic alarm sounds when the limit value is exceeded.

If you do not want an audible alarm, you can deactivate Audible Alarm.

4.2.6. Seam Naming

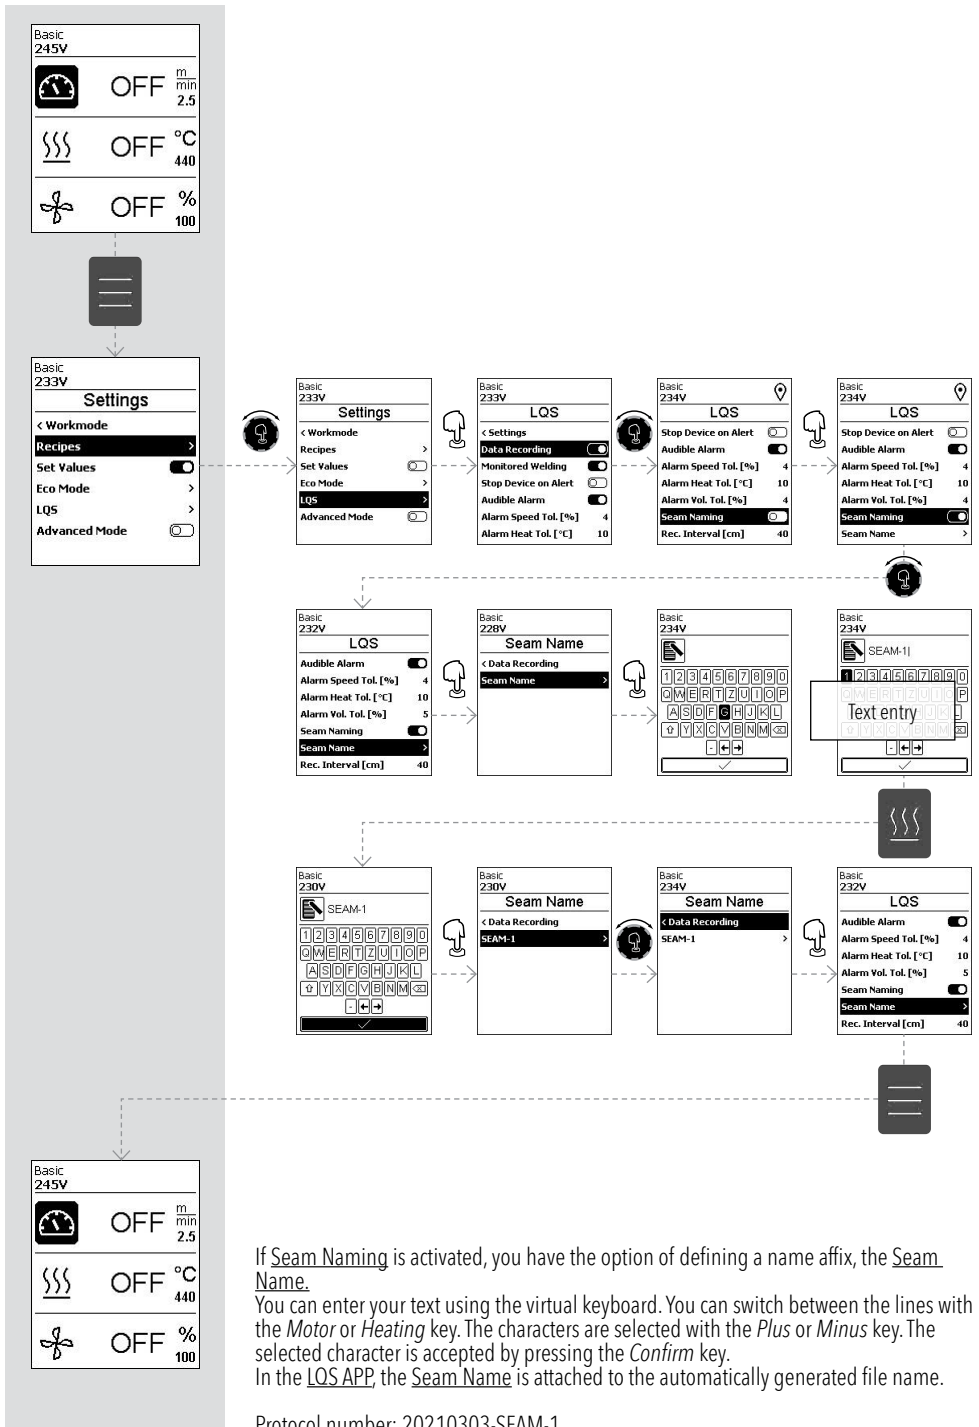

If Seam Naming is activated, you have the option of defining a name affix, the Seam Name.

You can enter your text using the virtual keyboard. You can switch between the lines with the *Motor* or *Heating* key. The characters are selected with the *Plus* or *Minus* key. The selected character is accepted by pressing the *Confirm* key.

In the LQS APP, the Seam Name is attached to the automatically generated file name.

4.2.7. Recording Interval

Basic 229V	
LQS	
< Settings	
Data Recording	<input checked="" type="checkbox"/>
Test Welding	<input type="checkbox"/>
Monitored Welding	<input type="checkbox"/>
Seam Naming	<input type="checkbox"/>
Rec. Interval [cm]	40
Number of Files	24


You can set the recording interval individually according to the following table. Factory setting 40 cm.

Parameters		Setting range		Setting range imperial
Rec. Interval	[cm]	10-2000	[in]	4-787

4.2.8. Geographical position


If GPS is switched on, the GPS position data is logged in the data recording file.

In the status line (40), the symbol  is displayed when GPS reception is sufficient and position information is available. The symbol flashes when, for example, reception is insufficient and it waits for a valid position information.


Note: The WLAN connection status is also displayed in the same position in the status line. If a WLAN connection to the myLeister App is present, the symbol  is displayed, even when GPS position information is available.

Basic 229V	
LQS	
Seam Naming	<input checked="" type="checkbox"/>
Seam Name	>
Rec. Interval [cm]	20
Number of Files	1
Free Memory [MB]	7621
GPS	<input checked="" type="checkbox"/>
GPS Position	>

Basic 229V	
LQS	
Seam Naming	<input checked="" type="checkbox"/>
Seam Name	>
Rec. Interval [cm]	20
Number of Files	1
Free Memory [MB]	7621
GPS	<input checked="" type="checkbox"/>
GPS Position	>


Basic 236V	
GPS Position 	
< Data Recording	
Latitude	
N 46° 54.8265'	
Longitude	
E 8° 15.5510'	
Elevation	
470.20 m	


5. Running Welding Data Recording

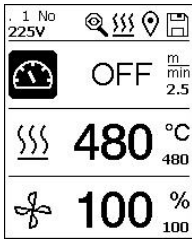


- Set parameters for welding data recording.
- Set the target values for temperature, speed, and blower power (see the device operating instructions).
- Switch on the heater.


In the status line (40), the file number is displayed alternately in the supply voltage display, and the  symbol flashes.

If Stop Device on Alert is activated, the symbol  is also displayed.


If GPS is activated, the symbol  is also displayed.

If the GPS symbol flashes, satellite data is sought. If the GPS symbol is black, GPS data are available. If the GPS symbol remains white, no data can be received.

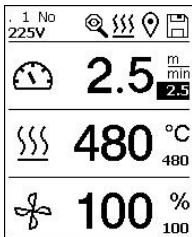

The drive and recording start as soon as the welding nozzle is inserted into the overlap. In the status line (40), the file number of the file is displayed alternately to the supply voltage display and the symbol  is shown. If a set alarm value is exceeded during the welding process and Monitored Welding is switched on, this state is shown on the screen by a red backlight.

Remove the welding nozzle from the overlap at the end of the weld.
The drive and recording are stopped.

The next log file is being prepared. In the status line (40), the file number of the new file is displayed alternately to the supply voltage display and the symbol  flashes.

Finish welding

- After finishing welding work, switch off the heater.
- Wait until Cool down is finished
- Switch off device with main switch.

6. Welding Data Recording

6.1. Representation of limit value exceedance





If Monitored Welding is activated, temperature, speed, blower power and mains voltage are continuously monitored during welding to ensure that they are within the defined limit values.

If a limit value is exceeded, this case is displayed on the device and logged in the data file.


The backlight of the display flashes red. If the Audible Alarm is switched on, an additional alarm signal sounds.

If Stop Device on Alert is activated, the welding process is stopped after 30 seconds in the event of a limit value deviation.

The limit values for the mains voltage are firmly defined. If the measured mains voltage is $<25\%$ $>20\%$, the welding process is also stopped. Regardless of whether Stop Device on Alert or Monitored Welding is activated.

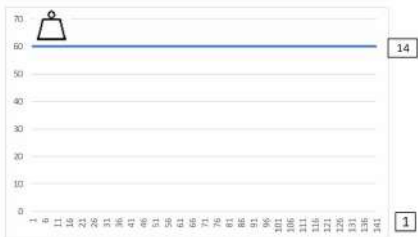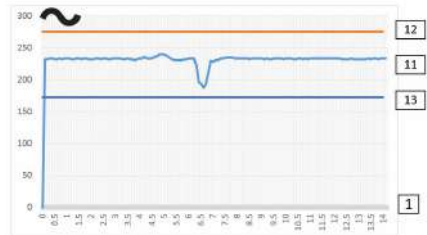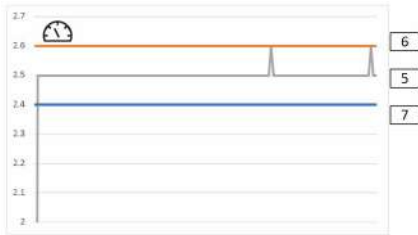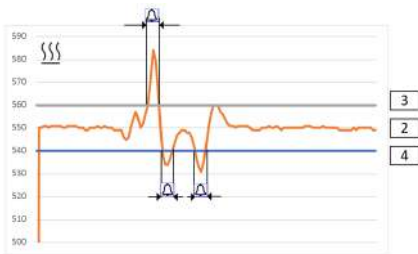

1. Distance
2. Current temperature limit
3. Maximum temperature limit
4. Minimum Temperature limit
5. Current speed
6. Maximum Speed limit
7. Minimum speed limit
8. Current blower power
9. Maximum blower power limit value
10. Minimum blower power limit value
11. Current mains voltage
12. Maximum permissible mains voltage
13. Minimum permissible mains voltage
14. Additional weight (optional)

If a parameter leaves the respective limit value, the backlight of the display changes to red. If Audible Alarm is activated, an additional alarm signal sounds. If Monitored Welding is activated, the limit deviation is logged in the data file. If Stop Device on Alert  is activated and the limit value deviation takes longer than 30 seconds, the welding process is interrupted.

6.2. Welding data files


A welding data file is created for each welding process. The welding process starts when the welding nozzle is swiveled in and ends when the welding nozzle is retracted. A weld consists of at least one welding process.

The name of the welding data file consists of the device identifier, date, time, a serial number, and optional file name affix.

The serial number starts with 001 at the start of each new day and can be a maximum of 999.

7. Welding Without Recording of Data

To perform a weld without data recording, LQS Data Recording must be switched off in the menu.
It is sufficient if only Data Recording is deactivated.

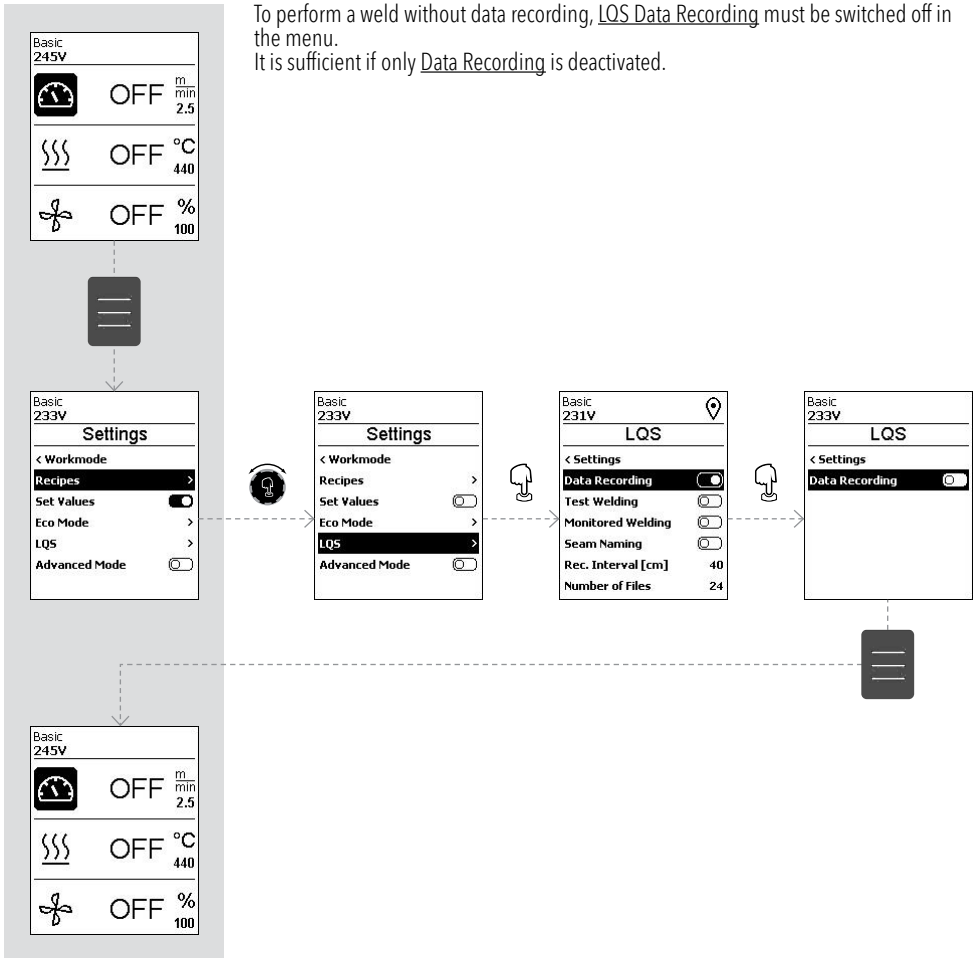

8. Behavior of Data Recording in Case of Power Outage


Condition of device prior to power outage	Duration power outage	Condition of device after power outage
Drive and heater are switched on (welding process and data recording).	≤ 5 sec	The device continues to run without a restart safeguard with the same settings as before the outage. Data recording continues and the data is added to the file that was created before the power outage.
Drive and heater are switched on (welding process and data recording).	> 5 sec	The device starts up and the start display appears on the screen. The welding data that was recorded before the outage is contained in the log file.
The device is not welding.	-	The device starts up and the start display appears on the screen.


 

9. Data Synchronization

The welding data files recorded by the automatic welder are read by the myLeister App and synchronized. The WLAN module of the automatic welder must be switched on for this purpose.

Important: Synchronize data regularly with the myLeister App. Otherwise, unsynchronized welding data can be lost on the device, e. g. in the event of a malfunction of the operating unit.

9.1. Switching on the WLAN module

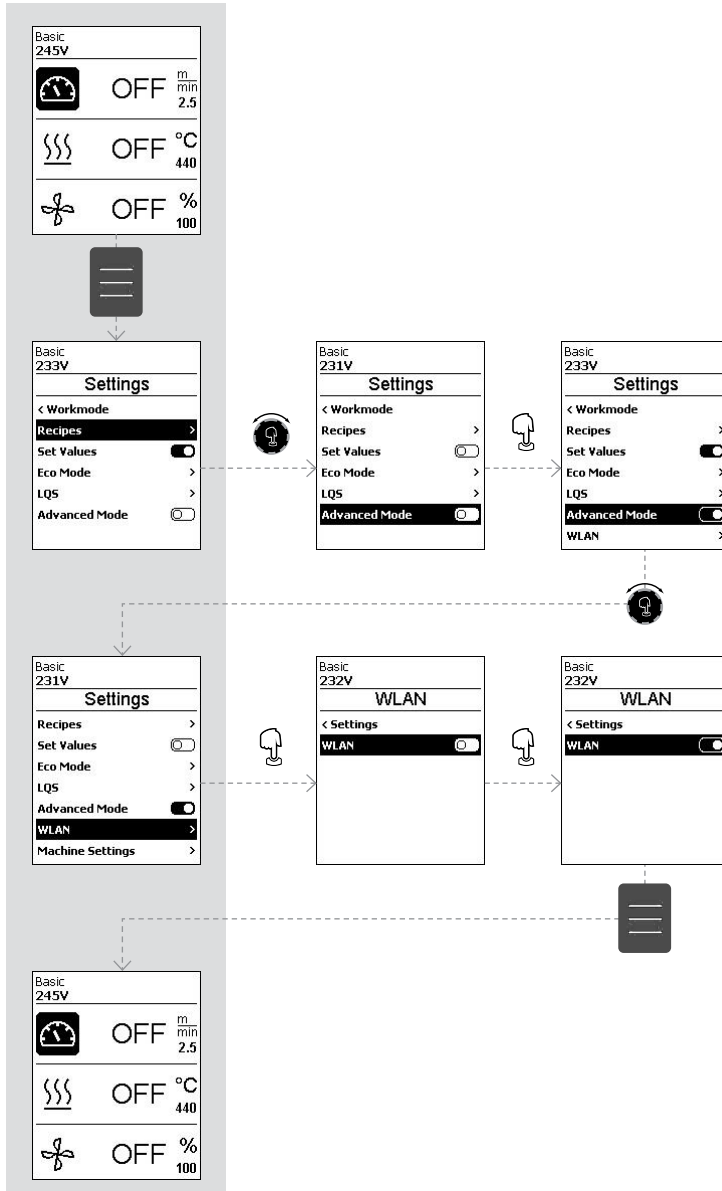

Basic 245V	
	OFF $\frac{m}{min}$ 2.5
	OFF $^{\circ}C$ 440
	OFF % 100



WLAN connection status display

The data exchange between the automatic welder and the [myLeister App](#) is carried out via the [myLeister App](#).

In the status line (40), the symbol  is displayed when the automatic welder is connected to the [myLeister App](#).

10. Warnings and Error Messages

- If there is a warning, the user can continue to work. More detailed information on the warning can be accessed via the keypad in the [Settings](#) menu under Warnings.
Important: If one of the warnings listed below occurs, data recording cannot be used.
- If an error occurs, the unit turns off the heater and the drive is no longer released.

Display	Error code / Warning message	Error description
0200 0100	Unknown HMI Version	An error occurred during the initialization of the operating unit ¹
0200 0080	Date/Time	An error occurred during the initialization of the date and time function.
0200 0040	Date/Time	The current date and time information is invalid.
0200 0020	Memory Full	Memory card for data recording is full. The  symbol flashes in the status line (40) during data recording.
0200 0008	Memory Card Access	A problem with the memory card occurred during data recording. In this case, welding data is no longer recording, but welding continues. The  symbol flashes in the status line (40).
0200 0004	WLAN Module Access	There is a problem with the WLAN module ²
0200 0010	GPS Module Comm.	The GPS module is not sending any data ³

¹ In this case, the basic functions of device operation are available to the user, allowing them to weld without data recording.

² Data recording can be used when these warnings are displayed. In these circumstances, it must be ensured that data cannot be transferred from the device to the [myLeister App](#) due to the problem.

³ Data recording can be used when these warnings are displayed. It must be ensured that no position data is in the data file when the [GPS](#) is activated.

Error code / Warning message	Action
Unknown HMI Version	Switch off the device and restart after a few seconds ⁴
Date/Time	Switch off the device and restart after a few seconds ⁴
Invalid Date/Time	Set date and time in the <u>Settings</u> menu under <u>Machine Settings</u> at <u>Date & Time</u> .
Memory Full	Synchronize date with the <u>myLeister App</u> ⁴
Memory Card Access	<p>Switch off data recording in the menu and restart:</p> <ul style="list-style-type: none"> ▪ Switch the drive off. ▪ In the Settings menu under <u>LOS</u>, set Data Recording to 0. ▪ After a few seconds, reset <u>Data Recording</u> to 1 and exit menu. ▪ Restart the drive. (Heating must also be switched on.) ▪ The log file is prepared. The warning should no longer be displayed in the status line (40). <p>If the warning is still generated:</p> <ul style="list-style-type: none"> ▪ <i>Switch off drive and heater.</i> ▪ Switch off the device with the <i>main switch</i>. ▪ Restart the device after a few seconds. ▪ Restart <i>heater and drive</i>. ▪ The log file is prepared. The warning should no longer be displayed in the status line (40) ⁴
WLAN Module Access	Switch off the device and restart after a few seconds ⁴
GPS Module Comm.	Switch off the device and restart after a few seconds ⁴

⁴ If the warning is still displayed, contact the Leister Service Center.

11. Quick Guide LQS App

App version

myLeister 2.10.0

About this document

This quick guide describes the most important steps on the following topics:

- Initial Start
- Set up Cloud work mode Shared
- Devices
- LQS Functions
- Recipes
- Tools
- Documents
- Settings

11.1. First start

When first starting the app, you will be requested to accept the end user licensing agreement and the data protection statement.

Read both documents carefully and acknowledge them to enable you to use the app.

Registration/Login

- As soon as you have accepted the end user licensing agreement and the data protection statement, you are prompted to log in.
- If you already have a Microsoft, Google, or Facebook user account and would like to use this account for the app, please log in with this user account.
- If you want to create a new user account, please select [Register now](#).

In the new window, enter the following information:

- E-mail address: Enter a current valid e-mail address. You will receive a confirmation e-mail sent to this e-mail address.
- Click on Send verification code.
Check the mailbox of the e-mail address indicated. The confirmation e-mail contains a code.
- Enter the code in the input field and press Check code to complete the process.
- New password: Assign your password.
- Confirm new password: Enter the selected password again.
- First name: Enter your first name here.
- Last name: Enter your last name here.
- Display name: Enter your first name and last name here.
- Industry sector: Enter here the industry sector in which your company is active.
- Click on [Create](#) to complete this process.

Your private cloud will then be configured in the background. You alone have access to these data. Your work mode will be set to Private Cloud.

If you already have a myLeister user account, you can simply log in and you will have access to your cloud data.

Update your existing LQS app with work mode Local

If you have used an existing LQS installation in local mode on your terminal and this installation has now been updated to the new myLeister App, you can skip the login when starting and continue working with your local data as usual.

Important

In this work mode, your data is only located on your workstation.

To protect yourself against data loss, we recommend that you regularly back up your data from your workstation.

Important

Subsequent transfer of local data to the cloud is impossible.

11.2. Update existing LQS app with Cloud work mode

If you have used an existing LQS installation in Cloud mode on your terminal and this installation has now been updated to the new myLeister App, you will automatically be logged in with your user data. Your existing cloud data will automatically be stored in a shared cloud. All users with the respective authorizations will also be transferred.

Furthermore, a private cloud will set up for you to which only you have access. Your work mode will automatically be set to shared cloud so that you have direct access to your existing LQS data.

11.3. Configuring the Cloud Sharing work mode

With the Cloud Sharing work mode, you can share your data with different users. You can invite new users or remove existing users.

- To use the Cloud Sharing work mode, go to Settings > Create account for company.
- You can then add under the Item Company the company name, address, city, zip code, and country. Complete the process by clicking OK.

As the creator of the shared cloud, you are automatically defined as the administrator.

If you work with the shared cloud, you can manage your company and the users under Settings > Account. Only users with administrator rights can manage all sections.

11.4. Managing the company and users

Company

As administrator, you can manage the company information.

- Click on [Company](#). The window that opens contains the information about the company that you can now adjust accordingly.

User management

As the administrator, you can register other employees of your company as users. Create an individual user account for each employee.

The user administration can be found under [Settings](#) > [Account](#).

- Click on [User Management](#).
- Click on [Add Users](#).
- Enter a current valid e-mail address for the new user.
- Option [Administrator](#): Select this option if the new user is also supposed to have administrator rights. You can also assign or withdraw this right to or from existing users at a later time.
- Complete the process with [Save](#).

The employee must then perform the following tasks:

- An invitation mail will be sent to the e-mail address indicated.
The user receiving this invitation must activate the link contained in the e-mail. This will link the user to the registration page.
- Once on the registration page, he must proceed as follows:
If the user received the invitation mail via his Microsoft, Google or Facebook user account, he must click on the corresponding account icon and log in.
If the user received the invitation mail via the e-mail address of his existing myLeister user account, he must log in directly with his user name and password.

This action completes the registration process for the new user.
In all other cases, the user selects [Register now](#) and registers.

In the new window, the following information must be entered:

- E-mail address: Enter the e-mail address to which the confirmation e-mail was sent.
- Click on [Send verification code](#). Check the mailbox of the e-mail address indicated.
- To complete the process, enter the code you received in the confirmation e-mail and complete the process with [Check code](#).
- New password: Assign your password.
- Confirm new password: Enter the selected password again.
- First name: Enter your first name here.
- Last name: Enter your last name here.
- Display name: Enter your first and last name.
- Industry sector: Enter here the industry sector in which your company is active.
- Click on [Create](#) to complete this process.

Delete user

As administrator, you can delete the user from your shared cloud.

- Click on [User Management](#).
- Click on the user name that you wish to remove from the shared cloud.
- Click on [Delete](#) to complete this process.

The deleted user can now no longer access the data in the shared cloud. The data created by the user remain.

Logout

You must sign out if another employee wishes to work with the app at the workstation using his user account.

Change user

Perform the following steps to change users:

- Click on the menu with the user name.
- Click on [Logout](#).
- The start screen is displayed.
- Log in using your user name and password.

Work mode Local

The local work mode is now only available on terminals that have updated an LQS installation with local data to the [myLeister App](#).

If you work in local work mode, you do not need to log in as a user.

Important

In this work mode, your data is only located on your workstation.

To protect yourself against data loss, we recommend that you regularly back up your data from your workstation.

Important

Subsequent transfer of local data to the cloud is impossible.

The following functions are available to you:

- Register devices.
- Synchronize data files from the device and retrieve archives from the device.
- Evaluate and edit raw welding data.
- Manage
- LiveView
- Toolbox

12. myLeister App User Interface



12.1. LQS



Here you can see your registered devices. Even deleted devices are listed here.

Any welding data recorded can be transferred from the welding device to the app with the LQS functions. These data can then be evaluated for quality assurance/monitoring purposes and saved as a PDF report.

12.2. Devices



You can see all active, registered devices under [Devices](#). With the button, you can add 🔍 new devices.

12.3. Recipes



With the recipe function, welding parameter combinations can be saved in the app and synchronized via the cloud. These recipes can then be transferred to compatible welding devices. Profiles configured on welding devices can be transferred to the app.


12.4. LiveView



The [LiveView](#) offers the possibility of displaying and monitoring the set welding parameters and the effective parameters of the welding device in real time, both during and after a welding operation. In addition, warnings and error messages are displayed.

- Select the desired welding device.
- Click on [LiveView](#). This option is only active if the selected device is active and supports the LiveView function.

The [LiveView](#) of the selected welding device opens. You now see the current parameters as well as warnings and error messages.

By clicking on [Settings](#),  the setting overview of the device opens. Now, you can adjust all relevant settings. The settings will then be transferred to the welding device when you exit the menu.

12.5. Configuration Management



The NFC function can be used to communicate with devices that support NFC.

This function is only available with Android devices. The VARIMAT 700 does not support NFC.

12.6. myLeister AR App



The [myLeister AR App](#) enables you to display the Leister welding tools* as an interactive application and Augmented Reality application (AR) on your mobile devices. Let us show you the various application possibilities on your Leister equipment with the touch of a button. Turn the Leister products virtually on their own axis and view all details from any perspective.

12.7. Settings





LQS settings

Before you begin evaluating the data, adjust the settings for the LQS function.

Company logo for the header of the PDF report

You can add a company logo, which is displayed in the header of the PDF report. For optimum presentation of the logo, the logo graphic should display an aspect ratio of 10:1.

 - Select [Add](#) . Then, select the graphic for the logo in the dialog window that opens.
- To remove a logo that has been added, select [Delete](#) .

PDF report title

Select which title should be displayed on the PDF report.

- Activate the desired title for the report.

Graphics

- If you wish to include the graphics in the report as attachments, activate this option.

CSV Export Settings

If you synchronize the data files from the device to the workstation, you can create a CSV file from these data files.

- Activate this option if you wish to create a CSV file from the raw data file.

Windows:

- If no memory location has been defined, a dialog window opens in which you must specify the memory location of the CSV files.
- Click on [Change path](#), if you wish to export the CSV files in a different path.

Android:

The CSV files are automatically saved in the internal device memory under [Documents](#) > [myLeister](#) > [Leister LQS](#) > [CSV Files](#).

iOS:

The CSV files are automatically saved on the iCloud drive in the folder [myLeister](#) > [LQS](#) > [CSV Files](#).

Note: Select this option, **before** you synchronize the data files from the device.

Construction Projects

Here you can manage your construction projects.

- Click on [Construction projects](#).
- Click on [Add](#) to create a new construction project.
- In the new window, you can enter the following information:
 - Description: Indicates the name or transcription of the construction project.
 - Street, city, zip code, country: Information about the address of the construction project.
 - Option Active: This option is selected as standard.

If you no longer wish the evaluated site data to be displayed in the list of construction projects, de-select [Active](#).

- Click on [Save](#) to complete the process.

Machine Settings

Here you can find the settings for the registered devices.

Date and Time

Define whether date and time on the connected welding devices should be synchronized automatically with the system date and system time on the terminal.

They are updated once daily during a welding data synchronization process. The automatic update is only carried out for devices with HMI firmware version 1.06 and higher.

Selecting the language (Windows version only)

This option enables you to change the language of the myLeister App. As standard, the app chooses the language according to the workstation operating system.

- To change the language, select a language from the list.
- Restart the app.

General Settings

Notifications

This is where you can switch notifications from the app (notes, etc.) on and off. Error messages will continue to be displayed even if notifications are switched off.

Preferred card provider (for coordinates, etc.)

This is where you can select which card provider should be used for coordinate visualization (e.g., for the coordinate links in the PDF report).

12.8. Help



You can find more information about the [myLeister App](#) in the help menu.

13. Registration of Devices



To enable the myLeister App to communicate with a welding device and for all available functions to be activated, this device must be registered once in the myLeister App.

Click on the menu [Devices](#) on [Search devices](#).

After a short time, the device will be listed with the note [Device added](#) and a plus sign.

Click on the device and in the machine settings [Register device](#).

A code will be shown on the device display. Enter this numeric code in the app window and confirm by clicking on [Register device](#).

Additional functions are now available with the registered device. The availability of the functions depends on the model and/or firmware status of the device:

Inventory Number

Under the item [Inventory number](#), a unique identification can be assigned to the device.

Enter the desired designation in the text field and save the input.

Delete Device

Click in the [Device](#) menu on the device you wish to remove.

Then click on [Delete device](#). Confirm the subsequent security prompt.

Note: Data of this device in the app will **not be deleted**. The device continues to be shown in the LQS menu.

For more information, see Chapter  14. LQS Functions.

14. LQS Functions

Before starting with the LQS function, configure the function in the settings:

- Follow the steps in the section Settings under [LQS Settings](#).

If you selected the [LQS](#) menu, you are shown all devices you registered.

14.1. Synchronizing data from the device.

Click on ✓ and then on 🔍. The device from which you wish to synchronize the welding data and which is currently connected to the app is now highlighted.

Click on 🔄. It can only be synchronized if the device in question is indeed available. Otherwise the button cannot be activated.

14.2. Restoring an archive of the device

- Click on the device from which you wish to synchronize the data, on ☰.
- In the dialog window, select the archive folder from which you wish to retrieve the data.
Start restore data with [Restore](#).

14.3. Evaluating welding data

Before evaluating the welding data, you must synchronize the date of the device in accordance with Section [☰ 14.1](#).

- In the list of devices, click on the device from which you wish to evaluate the welding data.
- All data files will now be listed. They are sorted by date and time, starting with the most recent file. Data files yet to be evaluated are shown in bold print.
- Click on the name of the raw data file and continue by clicking on [Evaluate](#) ✎.
- You will now be guided through the evaluation steps.
At the top of the screen, you can find information concerning the selected data file and the step you are currently performing.

Protocol

This is where you enter all the information to create a protocol. Mandatory fields are marked in red. Here, you have the possibility of adding a construction project or manage your construction project. Just click on [Add](#) +.


Graphics

The progress of the parameters recorded, such as temperature, speed and joining force, is displayed over the weld seam length. You can zoom in on the diagram. See Section [☰ Navigation](#) in the graphic diagram.

Note: In the [LQS Settings](#) menu, you must select in the tab [Graphics](#) the option [Add diagrams to PDF report](#), if you want the charts in the report to be included as an attachment.


Table

The summary of the values of the weld is presented in tabular format.

All recorded values can be displayed under [Records](#) .

Where the set limit values were left, the corresponding values are marked in red.

Select the option [Brief report](#) if you only want to see and to have documented the values for which the value limits set were not observed.

With [Save](#)  you can save your evaluation and export it additionally as a PDF or CSV file:

Windows:

A dialog box appears in which you can select the storage location for the PDF or CSV file.

Android:


The selected files are automatically saved in the internal device memory under [Documents](#) > [myLeister](#) > [Leister LQS](#).

iOS:

The selected files are automatically saved on the iCloud drive in the folder [myLeister](#) > [LQS](#).

14.4. Navigating within graphics (Windows version only)

Zooming:



 
- If you hold the pointer over the diagram and turn the scroll wheel, you can zoom in or out of the graphic. The zoom affects both axes at the same time.
- If you only wish to zoom the horizontal axis, hold the pointer over the distance scale and turn the scroll wheel.
- If you only wish to zoom the vertical axis, hold the pointer over the corresponding vertical scale and turn the scroll wheel.
- Click [Zoom Full View](#)  to return all graphs to full view.

Show the detailed view:

- If you draw a plane in a diagram, this section is displayed on the left as a detailed view.
- If you wish to delete the detailed view created, select the view and press on the trash can icon.

Note: In the menu [Settings](#) > [LQS Settings](#), in the section Graphics, you must select the option [Add diagrams in PDF report](#) if you want to have the diagrams in the report as an attachment.

Edit reports



- Click in the main view of the LQS function on .
- Select the construction project from the list.
- All evaluation files are now listed which have been assigned to the selected construction project. They are sorted in descending order by date and protocol number.
- Click on the protocol and continue by clicking on [Evaluate](#) .
- You will now be guided through the evaluation steps again. For details, see Section  Evaluate welding data.



15. Recipes



With the function **Recipes**, you manage your preferred welding parameters. Send your parameters to all your registered Leister devices (as a prerequisite, a device must have a compatible WLAN system and compatible firmware). Read your recipes (welding parameters) from your devices and share them through the **myLeister Cloud** in your group or company.

- Select a registered device from the list.

The left-hand list now shows all the recipes saved for this type of device. The right-hand list shows the recipes that are available on the selected welding device. If the selected welding device is not active (shaded in gray), the right-hand list is blocked and nothing is displayed.

Use **Add**  to add recipes to the left list. Please note that no more than 10 recipes can be saved on a welding device. Complete all fields and save the recipe by clicking on .

The created recipes can be moved with the arrows  and  from the recipe library to the selected device, or from the selected device to the recipe library.

To **edit** a recipe, it must be selected and then  must be selected. Use  to delete a selected recipe.

Recipes moved to the welding device are only transferred to this welding device after the menu is exited with .

16. Tools

In the **Tools** menu, you will find helpful functions that can support you in your routine tasks.

Power Cable Tester

Use the power cable tester to check if your power cable is the right size for your device or which power cable is ideal for your device.

- Fill out the nominal power rating of the welding device in W according to the type plate
- Complete the nominal voltage of the welding device in V according to the type plate
- Fill out the mains voltage in V
- Fill out the current mains voltage of the welding device in V if the welding device has a mains voltage display. The standard practice here is to enter the given rated voltage of the welding device minus 10%.

The current through the power cable and the power actually available to the welding machine is then calculated. The maximum possible power cable lengths for different power cable cross sections are also calculated.

Unit Converter

The unit converter helps you converting the globally relevant units of temperature, weight, area and many more.

Process Heat Formulas

The tool process heat formulas provide you with different formulas for evaluating the air heaters or blowers best suited to you and your application.

The myLeister App assists you with a simple configurator, in which you only have to enter the performance values required for your application.

17. Documents (Android and iOS versions only)

Under Documents, you will find all documents that have been created in and exported from the app, such as exported LQS reports.

The documents are stored in directories including the name of the relevant function.

17.1. Account

Under [Account](#), you can find the settings for your myLeister account. You also have the possibility of synchronizing the data created in the app in the cloud.

User administration

This is only available after a shared cloud was created. For more information, consult Section [☰ Setup of the work mode Shared Cloud](#).

Create company

Use this command to create a shared cloud. For more information, consult Section [☰ Setup of the work mode Shared Cloud](#).

17.2. Work mode

You can switch between different work modes under Work Mode Settings.

Work mode

Only available if local data are available on the terminal.

Switch between local mode and the cloud. If the cloud mode is activated and you have not yet logged in, you will be asked to log in.

Cloud mode

Only available if a shared cloud has been configured.

Switch between Cloud Private and Cloud Shared work modes.

Warranty

- The guarantee or warranty rights granted for this device by the direct distribution partner/salesperson apply from the date of purchase. In the event of a guarantee or warranty claim (verification by invoice or delivery note), manufacturing or processing errors will be rectified by the sales partner through replacement delivery or repair. Heating elements are excluded from warranty obligations or guarantees.
- Other guarantee or warranty claims are excluded within the framework of mandatory law.
- Damage resulting from natural wear, overload, or improper handling is excluded from the warranty.
- Devices that have been converted or modified by the purchaser are not covered by any warranty or guarantee.
- Only use original Leister spare parts and accessories; otherwise, any warranty or guarantee claims will be invalidated.

↳ Sales and Service Partners



Leister Technologies AG

Galileo-Strasse 10

6056 Kaegiswil

Switzerland

+41 41 662 74 74

leister@leister.com

leister.com